

Date: Thursday, 10/07/2008 1:38:42 PM
User: Julie Lecocq

Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	AFT X-TUBE EXT HEIGHT(-013)
Job Number :	40417		
Estimate Number :	10563		
P.O. Number :		Part Number :	D205596107
This Issue :	10/07/2008	S.O. No. :	
Prsht Rev. :	NC	Drawing Number :	D205596107
First Issue :	/ /	Project Number :	N/A
Previous Run :	40416	Drawing Revision :	B
	Type :	Material :	
	CROSSTUBES	Due Date :	24/07/2008
Written By :		Qty:	1 Um: Each
Checked & Approved By :	JUD 08.7.10		
Comment :	Est Rev:D 05.03.21 Added bending procedure KJ/JLM Est Rev:E 08-01-10 ECN 1075 DD Est Rev F 08.04.28 Added bending & mat'l EC verified by: DD		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
----------------	------------------------------	----------------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



JUD 08/7/18

**Comment:** DOCUMENT CONTROL

Photocopy D205-594 bluefile & type labels per PPP D205-596-107 CHG002

2.0	D6008180	Crosstube Extrusion
-----	----------	---------------------

**Comment:** Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Crosstube Extrusion

Batch: 40271

JP 8-7-22

3.0	BENDING CROSS	BENDING MACHINE - CROSSTUBES
-----	---------------	------------------------------

**Comment:** BENDING MACHINE - CROSSTUBES

Bend as per Dwg D2889 using CNC bender program

JP 8-7-22

4.0	CROSSTUBES	CROSSTUBES RESOURCE 1
-----	------------	-----------------------

**Comment:** LANDING GEAR RESOURCE 1

Mark 20.36" for cutting from tangential line in the straight section from D2890 as per Dwg wall template.

JP 8-7-22

5.0	QC15	DIMENSIONAL CHECK OF X-TUBES
-----	------	------------------------------

**Comment:** DIMENSIONAL CHECK OF X-TUBES

JP 8-7-22

B.40417 D205-596-107

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 10/07/2008 1:38:42 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT X-TUBE EXT HEIGHT(-013)

Job Number: 40417

Part Number: D205596107

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

6.0	CROSSTUBES	CROSSTUBES RESOURCE 1
-----	------------	-----------------------



Comment: LANDING GEAR RESOURCE 1

1-Cut as per Dwg D205-596-107

DP 8-7-22

2-Deburr & Inspect for surface damage. Polish cut surface. Scribe part # and batch # on one end of tube.

AWM 8-7-22

7.0	QC5	INSPECT WORK TO CURRENT STEP
-----	-----	------------------------------



Comment: INSPECT WORK TO CURRENT STEP

See 10/23 (X0)

8.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
-----	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1

AWM 8-7-22

Touch up ends of the tube with Chemical Conversion Coat per QSI 005 4.1

9.0	QC3	INSPECT POWDER COAT/CHEMICAL CONVERSION
-----	-----	---



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

See 10/23 (X0)

10.0	SPRAY PAINTING	SPRAY PAINTING
------	----------------	----------------



Comment: SPRAY PAINTING

1-Prime inside and outside with Immron per QSI 005 4.2

ml 08 07 23

(1)

11.0	QC14	INSPECT SPRAY PAINT
------	------	---------------------



Comment: Inspect Spray Paint

See 08 07 24 (1)

12.0	D3595063530	RUBBER CUSHION
------	-------------	----------------



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

RUBBER CUSHION

batch 38865

ml 08 07 24

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 10/07/2008 1:38:43 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT X-TUBE EXT HEIGHT(-013)

Job Number: 40417

Part Number: D205596107

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

MS2192028

Clamp(per MIL-DTL-8783C)



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)
clamp(per MIL-DTL-8783C)
batch 107502

ml 08 07 24



14.0

D29401

Support



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number

Description

Batch

2 D2940-1

Support

39390

ml 08 07 24

15.0

CROSSTUBES

CROSSTUBES RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1- Lightly scuff the bonded area using a 320 grit sand paper and clean the area with 41058 wash 'n' wipe

ml 08 07 24 (1)

2- Apply magnobond 6398 as per dwg D205-596-107

Magnobond 6398 Batch: 107621

EXP: 08/2009

3-Install supports and clamps per Dwg D205-596-107. Torque clamps to 80-100 in lb. as per dwg

ml 08 07 25 (1)

16.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 08/07/25 (1)

17.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-596-107

Location:

PPP Rev:

D

0 8/7/25 (1)

18.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

08/08/08 (1)

Job Completion



MF 08-07-31

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD		Work Order:	40417
Description: Crosstube High-High Aft		Part Number:	D205-596-107
Inspection Dwg: D205-596-107 Rev: B		Page 1 of 1	

Required Dimension	Min	Max
Height	29.7	29.9
1/2 Span	52.4	52.6
Angle	49	52
Total Span	104.8	105.2

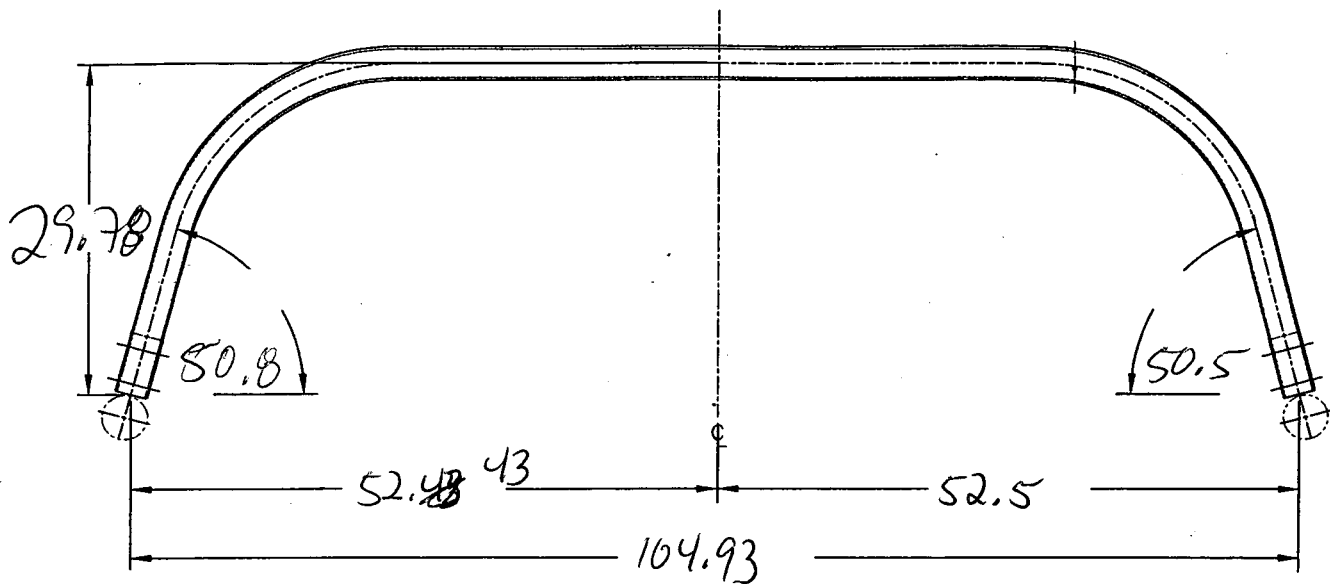

Comments

QC15 Inspection	<i>[Signature]</i>
Date	

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	<i>[Signature]</i>
B	08.04.21	Dwg Rev updated	KJ/JM	

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

PARTS LIST:

Qty	Part Number	Description
X	D205-596-107	CROSSTUBE ASSEMBLY, HI-HI AFT
1	D6008-180	CROSSTUBE
2	D2940-1	SUPPORT
4	D3595-063-530	RUBBER CUSHION
4	MS21920-28	CLAMP
A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURE FROM D6008-180
FINISHED LENGTH = 127.28 ± 0.02
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART 005 4.2
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH
VIBRATING STYLUS
- 7) WEIGHT: 50 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE
- 9) BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO
BENDING IS 6% BASED ON O.D.
- 10) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 11) APPLY A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2940-1 THAT
WILL BE IN CONTACT WITH THE CROSSTUBE. LET CURE FOR 12 HOURS AFTER INSTALLATION
AND PRIOR TO PACKAGING.
- 12) INSTALL MS21920-28 CLAMPS WITH D3595-063-530 RUBBER CUSHIONS TO SECURE D2940-1
SUPPORT ON THE TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE
CROSSTUBE SUPPORT.
**NOTE: IT IS ACCEPTABLE TO SUBSTITUTE MS21920-28 CLAMPS WITH LONGER OR SHORTER
MS21920-XX CLAMPS TO ACCOMMODATE VARYING DIAMETERS. ENSURE THERE IS A MINIMUM OF
1.5 THREADS IN SAFETY ON THE NUTS.**
- 13) TORQUE CLAMPS 80 TO 100 IN-LB

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 40417

B	SUPPORT NOW MAGNOBONDED; REMOVE D2856-600-1009 ABRASION STRIP; UPDATED NOTES; ADDED D3595-063-530 CUSHION	MB	07.12.03
A	NEW ISSUE	DS	02.11.20
REV.	DESCRIPTION	BY	DATE
DESIGN	<i>[Signature]</i>	DART AEROSPACE LTD—	
DRAWN	<i>[Signature]</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. B
MFG. APPR.	<i>[Signature]</i>	D205-596-107	SHEET 1 OF 2
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	CROSSTUBE ASSEMBLY, HI-HI AFT	NTS
DATE	07.12.03	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


8 7 6 5 4 3 2 1

D
C
B
A

D
C
B
A

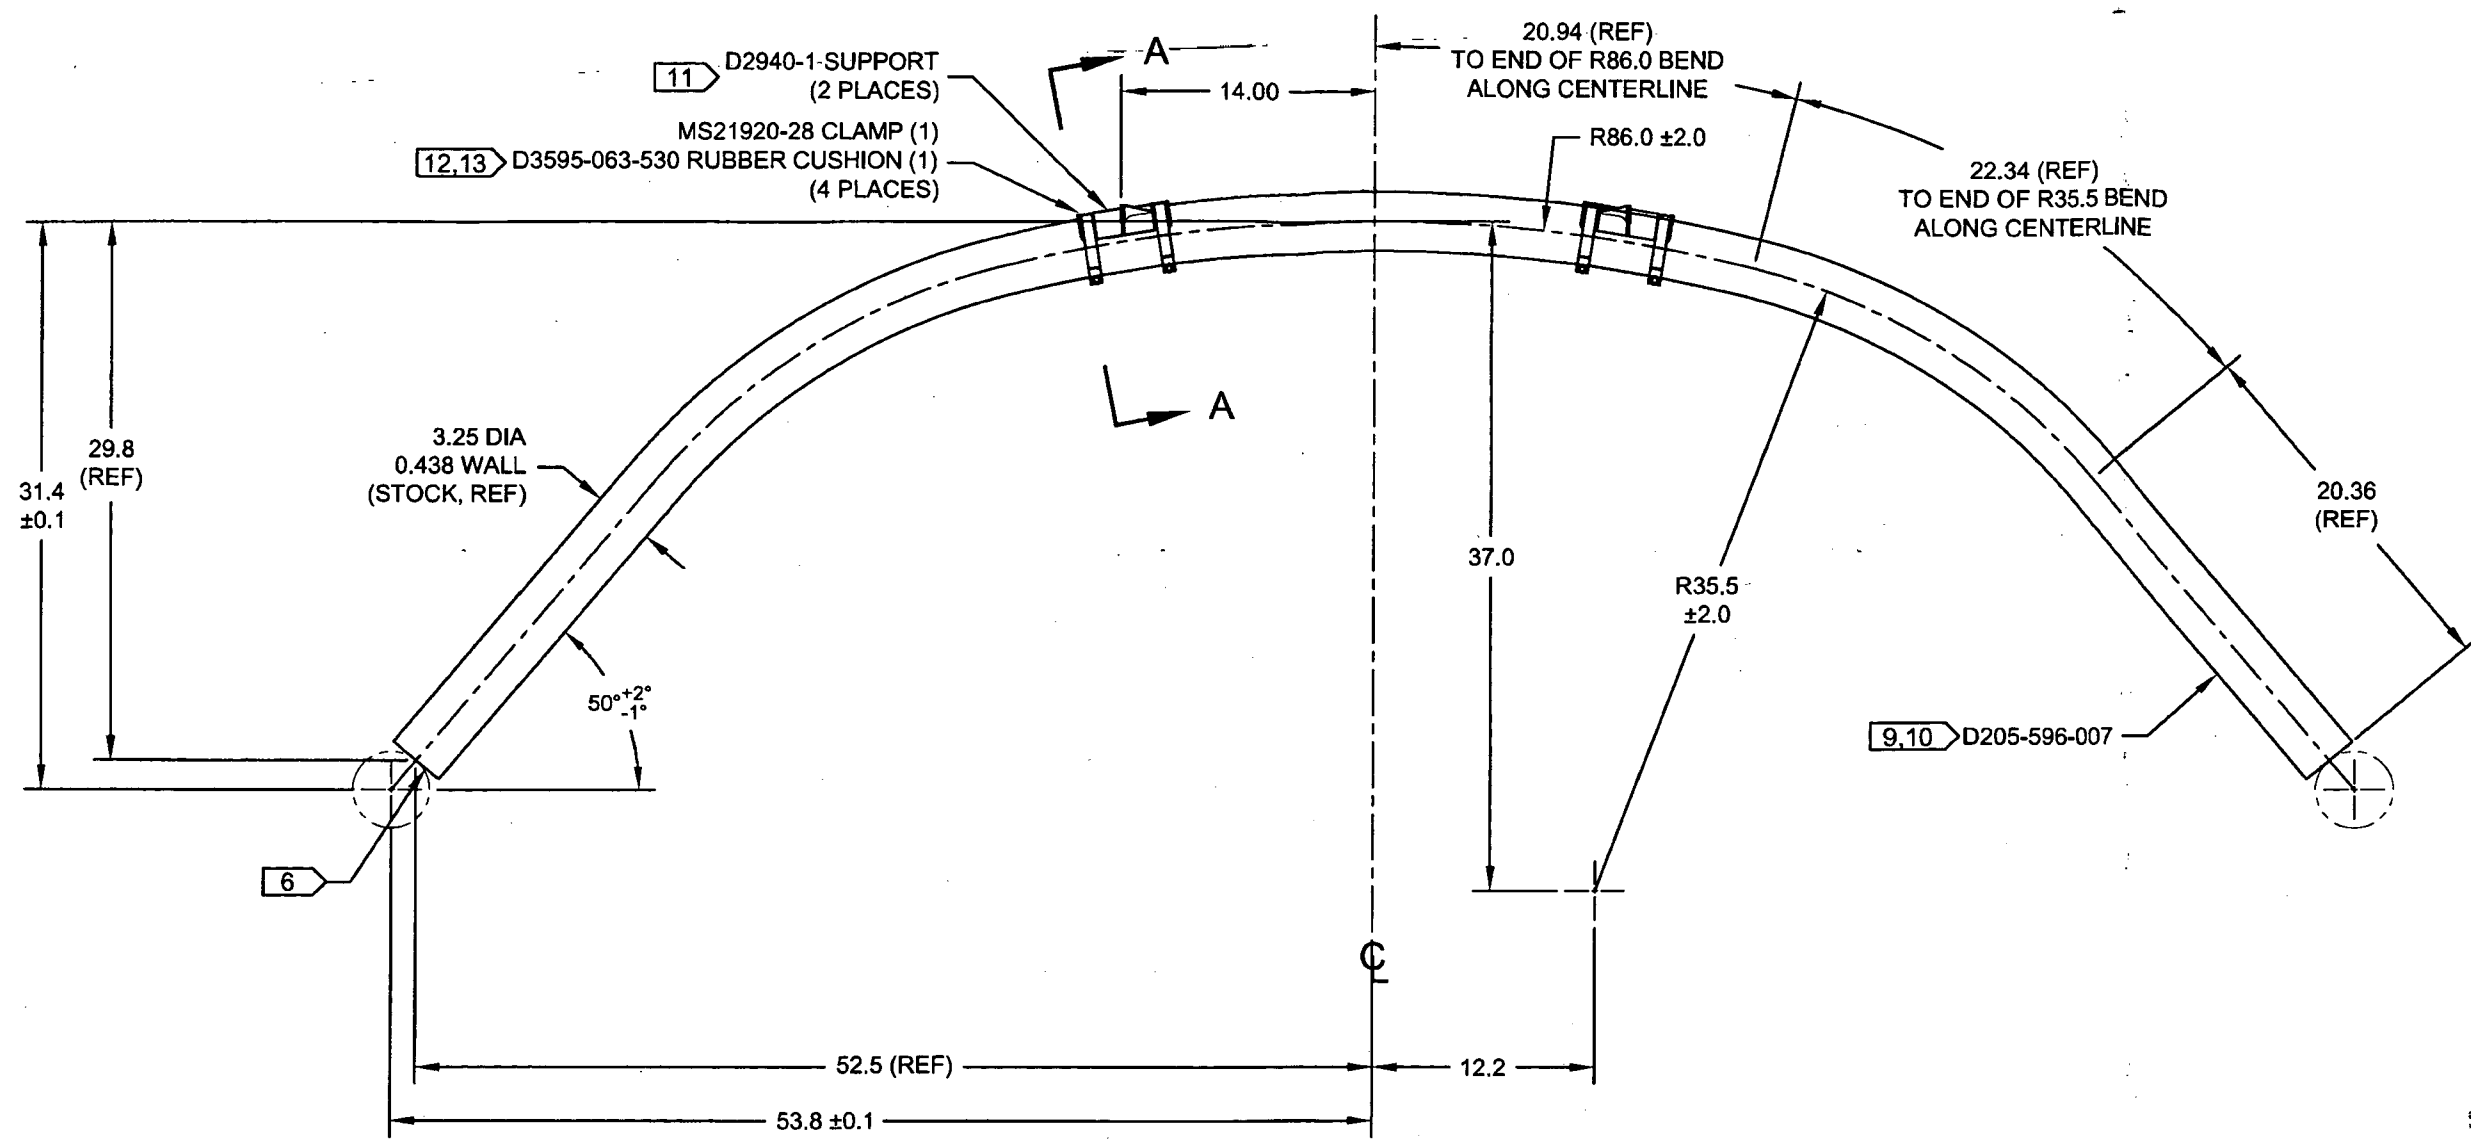

D205-596-107 CROSSTUBE ASSEMBLY, HI-HI AFT

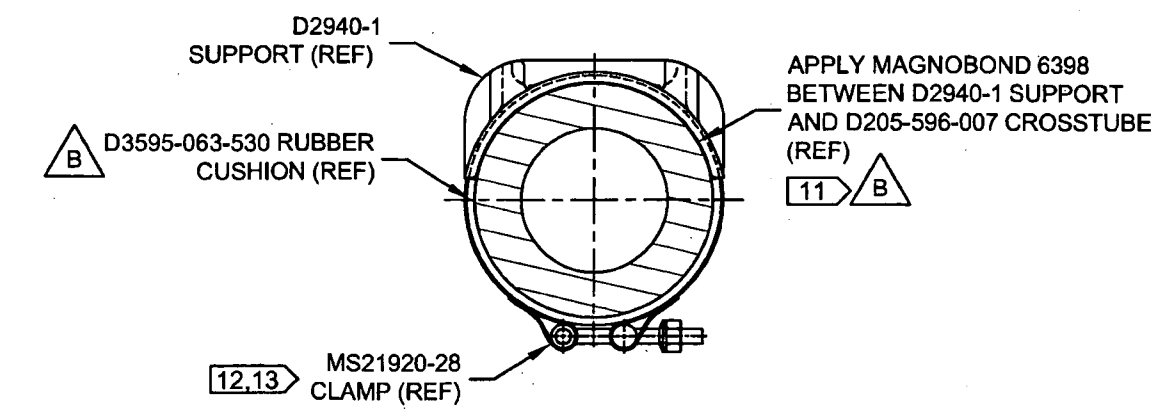

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 40417

RELEASED
28.01.16

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. B
MFG. APPR.		D205-596-107	SHEET 2 OF 2
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE ASSEMBLY, HI-HI AFT	1:10
DATE	07.12.03	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

8 7 6 5 4 3 2 1